

| YEAR: | RECORDING TACH TIME | TODAYS FLIGHT | TOTAL TIME IN SERVICE | Description of Inspections, Tests, Repairs and Entries must be endorsed with Name, Rating and Certificate Technician or Repair Facility. (See back pages for other s |
|--|--------------------------------------|---------------|-----------------------|--|
| 2/5/18 | Tach; 955.0 Hobbs 981.6 TT; 955.0 | | | N959TE Aircraft |
| <p>C/W FAR91.207d ELT inspection and operation test. Install new BP-1030 battery . New due date 3/2020. Replace fuse to passenger 12v power plug. Remove propeller. Install new alternator belt p/n 37A19773-376. Reassemble , torque prop bolts to 60ft/lb and secure with safety wire. Secure vacuum inop light in panel. Replace vacuum regulator filter p/n AAB3-5-1. Remove both fuel caps and replace internal and external seals. Replace right gear fairing shock mount p/n 10-01557. Clean and grease wheel bearings. Replace right fuel tank drain p/n F391-53S.</p> | | | | |
| <p>I certify that I have inspected this aircraft I/A/W an Annual type Inspection and was found to be in airworthy condition. AD summary Checked thru 18-01</p> | | | | |
| <p>The aircraft and/or component identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is approved for return to service. Pertinent details of the repair are on file at this station under Service Order No. 62183 Dated: 2-5-18</p> | | | | |
| <p>FAA Approved Repair Station No. B2ER144J Boshart Enterprises and Aircraft Services, Inc. Genesee County Airport Batavia, N.Y. 14020</p> | | | | |
| | | | | |
| | | | | |
| | | | | |

| YEAR | RECORDING TACH TIME | TODAY'S FLIGHT | TOTAL TIME IN SERVICE | Description of Inspections, Tests, Repairs and Entries must be endorsed with Name, Rating and Certificate Technician or Repair Facility. (See back pages for other s |
|---|--------------------------------------|----------------|-----------------------|--|
| 2/5/18 | Tach; 955.0 Hobbs 981.6 TT; 955.0 | | | N959TE Engine |
| <p>Drain oil and inspect filter. Blackstone oil sample taken. Install new AA48110-2 filter and 7qts Aeroshell 15w50 oil. Adjust both magnetos to 25BTC. Clean , gap and rotate spark plugs. Compression reads; 1)73 2)74 3)74 4)70</p> | | | | |
| <p>I certify that I have inspected this Engine I/A/W an Annual type Inspection and was found to be in airworthy condition. AD summary Checked thru 18-01</p> | | | | |
| <p>The aircraft and/or component identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Administration and is approved for return to service. Pertinent details of the repair are on file at this station under Service Order No. 62183 Dated: 2-5-18</p> | | | | |
| <p>FAA Approved Repair Station No. B2ER144J Boshart Enterprises and Aircraft Services, Inc. Genesee County Airport Batavia, N.Y. 14020</p> | | | | |
| | | | | |
| | | | | |
| | | | | |